iLX-F259

Software Update Procedure iLX-F259

9-Inch Halo9 Mech-Less Audio/Video Receiver with Apple CarPlay and Android Auto Introduction

- This installation manual is designed to take you through the step-by-step installation of the firmware version iLX-F259_3.0.7 (2020.01.13) update of the iLX-F259. Please familiarize yourself with the owners manual (found at www.alpine-usa.com/support) and if you still have additional questions please call 1-800-TECH-101.
- This firmware update corrects issues with the following: CarPlay and Android Auto volume range can now be set 0-35 Dimmer setting is default to Auto Adds answer/hang up steering wheel controls to CarPlay and Android Auto Improved FLAC playback through USB Blutooth Audio is lost after hanging up incoming call Strange grammer text in software update pop-up Play/Pause steering wheel controls are now working with CarPlay and Android Auto Incoming call with blocked number now working Bluetooth hands-free ring tone volume low CarPlay and Android Auto don't go into night mode CarPlay call quality issue when using iPhone 11

Caution!

- Do **NOT** turn off vehicle's ignition or head unit's power switch while updating. Some modern vehicles may shut down the ignition (ACC) if the engine is not running for some time. If you are not sure if this applies to your car, leave the engine running while the update is in progress.
- Do NOT remove the USB flash memory while updating.
- Do **NOT** press any buttons while updating.
- Do NOT update while driving.
- Failing to follow any of these cautions could cause damage to the head unit.

Step 1: Format The Flash Drive

- 1-1 Only flash drives formatted to FAT32 can be read by the head unit. This means that your flash drive can not be formatted to anything else including NTFS, exFAT, etc.
- 1-2 In Windows the drive can be formatted by right clicking on the drive in file explorer and selecting format as shown in the pictures below.



Step 2: Copy The Audio Update Files To The Flash Drive

2-1 Extract the downloaded files using a program like WinZip to your computer. If you don't have a program that handles zip files on your computer you will need to install one.

Name	Date modified Type	Size	
EBDJR.rar	Open Open O	356,883 КВ	
	Extract Here Extract Here Extract to FBDJR\ Scan selected items for vi Copen with Send to Cut Copy Create shortcut Delete	Date modified Type Size BY19/2019-4.02 PM Win4AR archive 355,883 KB 9/15/2019-4.02 PM File folder Educting from FBD/R.rer - X Addret E1970/R.rer extracy for f1.00/R.rer extracy for f1.00/R.rer extracy 12%	FBDIR.tar WinRAR archiv Date modified Size Date created
	Properties	Bigaoci Inve 0000037 Time kH 0000037 Processed 11% BigAgrand Proces Central Mode	

2-2 Once extracted you will see a folder named ILX-F259. Copy the unzipped folder to your flash drive by copy and pasting or dragging and dropping the file. The pictures below show the folder ILX-F259 on the flash drive and the folders in it. Note: You can **NOT** change the file names or folder names. The head unit will not recognize the files if you do. **DO NOT** just copy the files to the drive. You need to copy the folder.

I I I I I I I I I I I I I I I I I	5K (E:)			
← → ∨ ↑	Date modified Type Si 9/10/2019 11:42 AM File folder	ize		
This PC USB DISK (E) FBDJR		SK (E:) hare View		
🥏 Network		Copyin Name Copyin 11% c	Date modified 9/10/2019 11:42 AM	Type Size File folder

Notes:

*Do **NOT** store any other files on the flash drive. If there is anything on the drive besides the update folder it will not read correctly.

*Certain manufacturer's USB memory may not work. If so, try a different manufacturer's USB memory.

Step 3: Copy The Update Files To The Head Unit

3-1 Plug the flash drive into the USB connector of the head unit. The USB extension is typically ran from the back of the head unit to either the glove box or center console areas of the vehicle depending on the original installation.



- **3-2** Turn on the vehicle's ignition to power on the head unit. Do **NOT** turn off the igntion or the power of the head unit while the system is updating!
- **3-3** The update popup will automatically run. Select Yes.



3-4 The unit will reboot and begin the update. When the update is finished the head unit will reboot again



3-5 Check version iLX-F259_3.0.7 (2020.01.13) SETTINGS/GENERAL/ABOUT/VERSION INFORMATION. Then do a factory reset. SETTINGS/GENERAL/ABOUT/RESTORE FACTORY SETTING. Note: to get into the settings as always you will need to do the parking brake sequence. Engage the parking brake, release the parking brake, and engage the parking brake again.

	12:05 ам	8		12:05 ам	0
	Version Information	5		About	1
Serial No	RU00028AR90110023		Version Information	on	»
SYSTEM version	iLX-F259 3.0.7 (2020.01	1.13)	Warranty/Copyrig	pht Information	× // ×
Firmware version	S1087_0 115(0.3.3)		Restore Factory S	Setting	»
	01007_0110(0.0.0)				

Troubleshooting Guide

Symptom		Possible Cause	Remedy
1		The downloaded software was not unzipped.	Refer to Step 2. The .zip file will need to be unzipped first using your program of choice (for example, WinZip, WinRAR, Izarc, etc).
		There are other files on the flash drive.	The flash drive should be freshly formatted (refer to Step 1) and the only files on it should be the downloaded files as shown in Step 2.
	Head unit will not read flash memory.	The file folder name was changed or put into a different folder.	Make sure only the file that is shown in step 2 is copied over.
		The USB port was installed incorrectly.	Make sure the port is working correctly by plugging in an iPod or flash memory with a few MP3's on it and seeing if it will play the music. If that's not working then there's no way for the update to work. Try plugging the flash drive directly into the tuner without the extension cable.

iLX-F259