

# OPTIM Auto EQ Update Procedure

## PXE-C80-88

OPTIM™ Sound Processor and Amplifier with Automatic Sound Tuning

### Introduction


- This installation manual is designed to take you through the step-by-step installation of the firmware version 2.0.000 update for the PXE-C80-88. Please familiarize yourself with the owners manual (found at [www.alpine-usa.com/support](http://www.alpine-usa.com/support)) and if you still have additional questions please call 1-800-TECH-101.
- This firmware update corrects issues with the following:
  - Allows the use of the 2.99 PC software for setting up and tuning the system.
  - All key features of the PC software are available in the Android and iOS apps.
  - The Auto Anti-EQ algorithm has been updated.
  - Target curve presets have been added.
  - Center stage mode has been added.
  - A consolidated controller menu (removed “Main Source” menu with Coax, USB, and BT selection; must go into OPTIM App to make source selection).
  - Adds BassRev speaker tuning

### Caution!

- **Do NOT turn off vehicle’s ignition or head unit’s power switch while updating. Some modern vehicles may shut down the ignition (ACC) if the engine is not running for some time. If you are not sure if this applies to your car, leave the engine running while the update is in progress.**
- **Do NOT remove the USB flash memory while updating.**
- Do NOT press any buttons while updating.
- Do NOT update while driving.
- Failing to follow any of these cautions could cause damage to the head unit.
- **Do NOT use the prior version of the software if you have it (PXE-C80-C60.exe). Using the older version of the software can be permanently detrimental to the overall function of your PXE-C80-88 product.**


### Step 1: Unzipping The PXE-C80-88 Firmware

- 1-1 From the Knowledge Center on the Support page of the website you would have two files that need to be unzipped called AutoEQ2.0\_CSP8.zip and PC\_Ver02.990.002.zip. The file named AutoEQ2.0\_CSP8.zip is the new firmware for the processor. The file named PC\_Ver02.990.002.zip is the new software for tuning the processor using the PC.
- 1-2 Extract the downloaded files using a program like WinZip to your computer. If you don’t have a program that handles zip files on your computer you will need to install one.

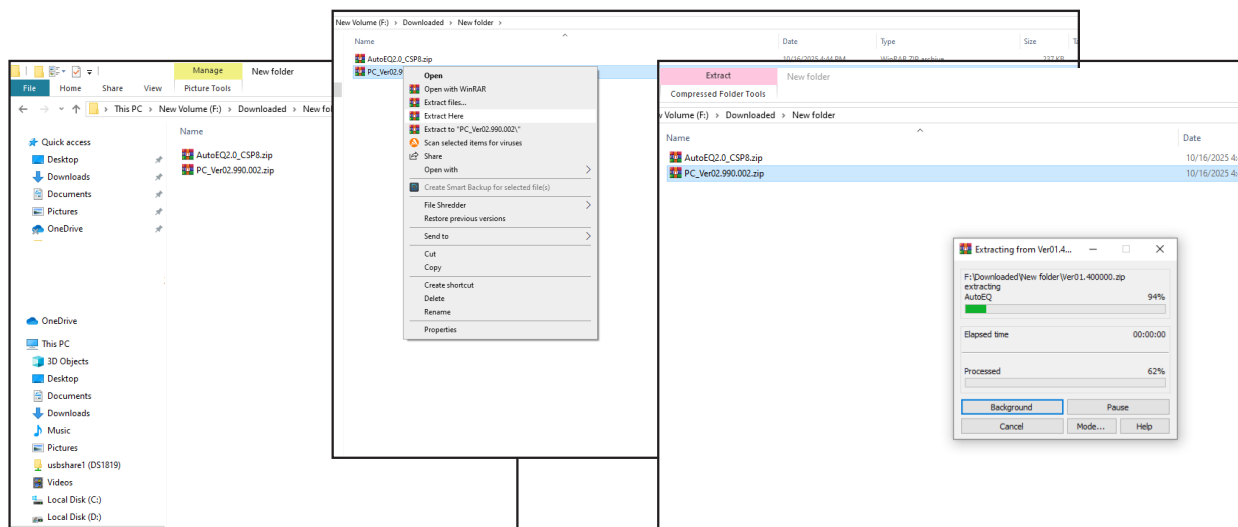


## Step 1: Unzipping The PXE-C80-88 Firmware Continued

- 1-3 The first picture shows what the unzipped files will look like. You will have one folder that has the PC software and the .bin file which is the update file for the PXE-C80-88.
- 1-4 The second picture shows what the PC\_Ver02.990.002.zip file folder will include when it is extracted. The ALPINE\_OPTIM\_DEMO.exe file is the one you need to double click on to launch the new software for the PC. If you have the old software still, DO NOT use that to do the update. You must use this new software to do the firmware update. Failure to do so could cause damage to the system.

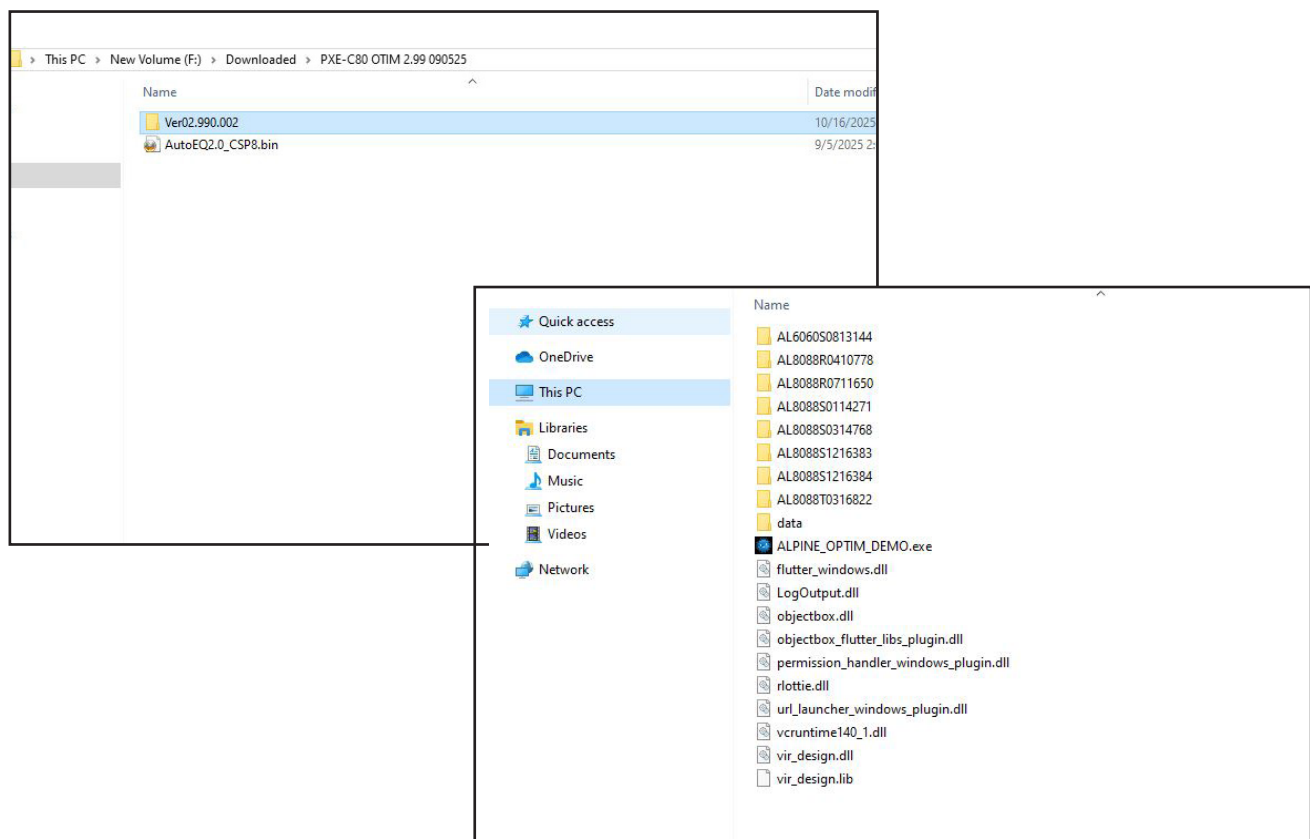


## Step 2: Updating The PXE-C80-88 Firmware

- 2-1 Open the ALPINE\_OPTIM.exe software application on the PC. Click on the upper left icon to connect to the DSP. The color of the icon will change from red to green to indicate that a successful connection has been made.
- 2-2 Power on the product and ensure the blue indicator light is on.
- 2-3 Connect one end of the USB-A to USB-A extension cable that came with the product to the USB port on the PXE-C80-88 and the other end to the USB port on your PC.

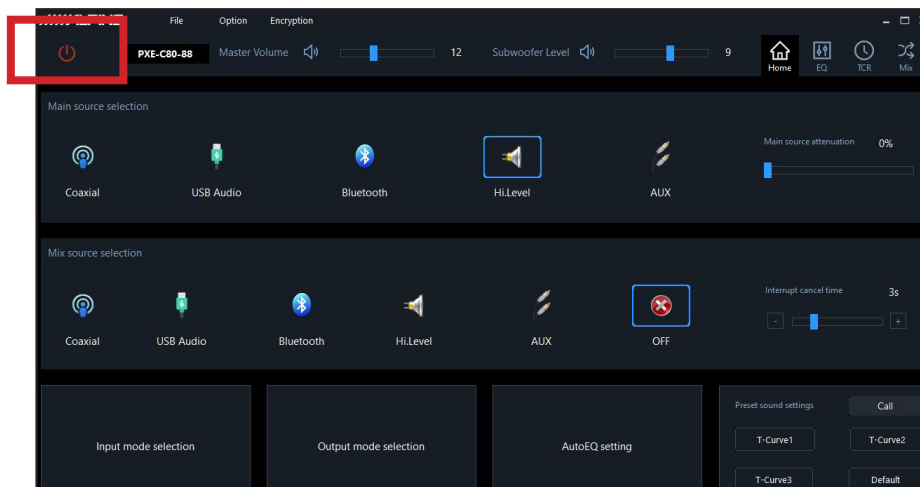


- 2-4 At the top of the menu select OPTION/FIRMWARE UPDATE.

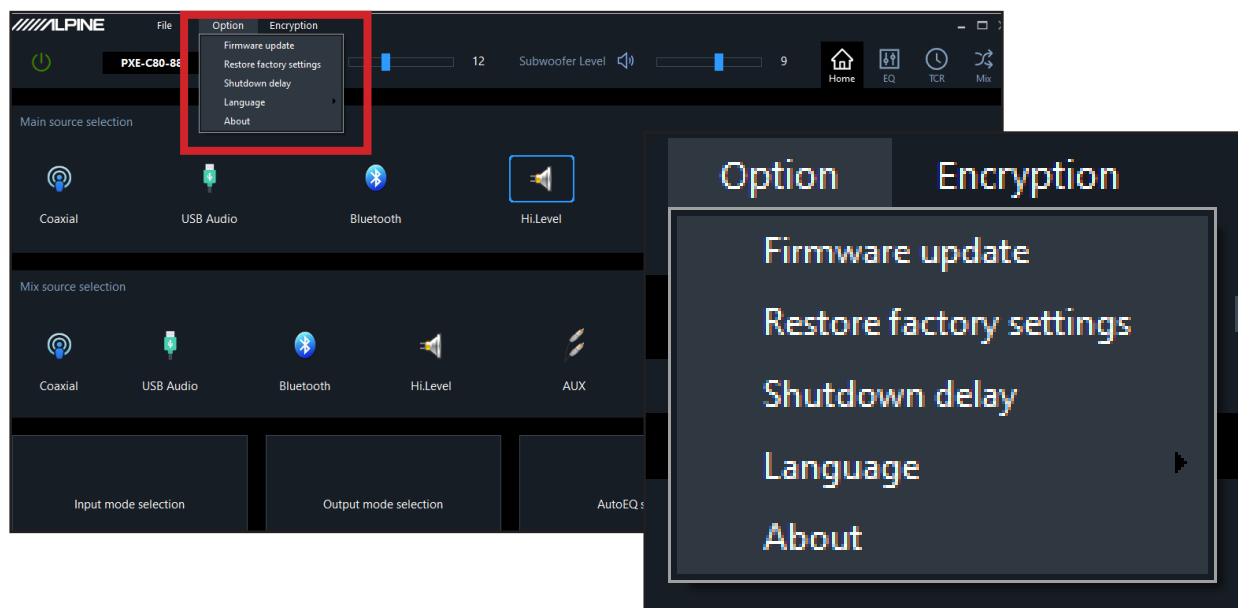

## Step 2: Updating The PXE-C80-88 Firmware Continued

- 2-5 This will popup the firmware update selection screen. Press the > button to select the firmware that you downloaded and extracted. It's the .bin file called AutoEQ2.0\_CSP8.bin.
- 2-6 Press update and wait for the loading bar to fully load. Once the process reaches 100%, which should take 6-8 minutes (but can vary with different PC connection speeds), a message should appear and state: "Firmware Update Has Successfully Completed". Click OK.
- 2-7 After the update has completed the unit will restart automatically.

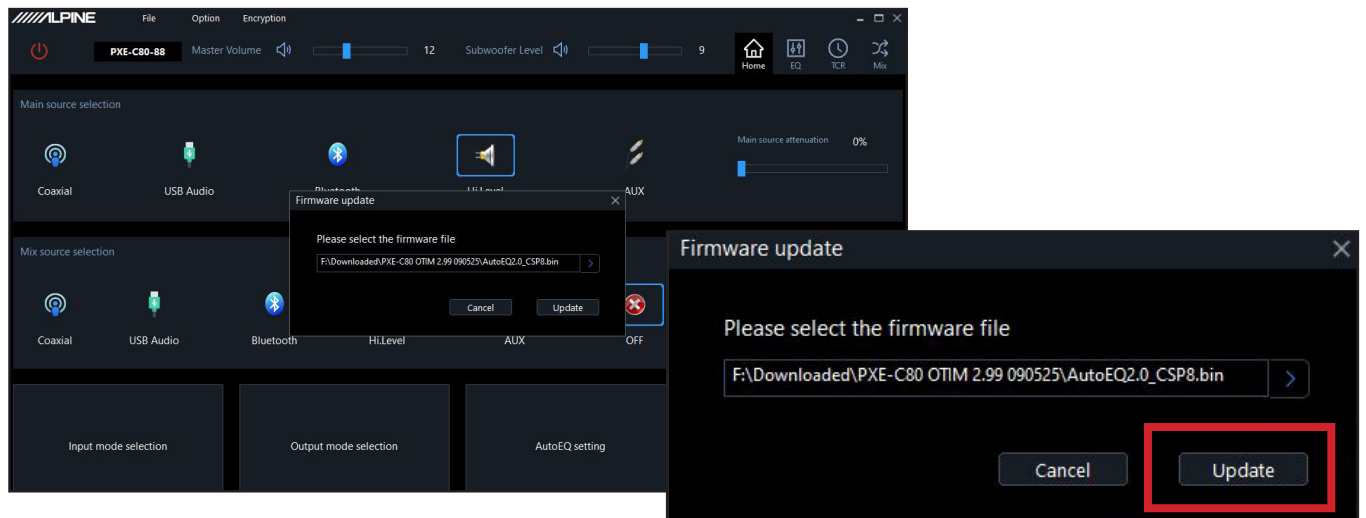

**Troubleshooting Guide**

	Symptom	Possible Cause	Remedy
1	Firmware update fails to reach 100%.	The downloaded software was not unzipped.	Refer to Step 1. The .zip file will need to be unzipped first using your program of choice (for example, WinZip, WinRAR, Izarc, etc).
Files were deleted or renamed.		Every file needs to be in every folder as shown. If that changes or the name changes of the any of the files it will not read properly.	
The file folder name was changed or put into a different folder.		Make sure only the file that is shown in step 2 is copied over.	
There's a USB connectivity issue.		Make sure the USB cable is seated properly into the USB ports. A different extension can also be tried. Disconnect the USB extension and power cycle the processor (On, Off, On), plug the extension back in, and try again.	